

# DART SERVICE BULLETIN SB11-3

## AFFECTING:

**D206-558-041 SINGLE MIRROR INSTALLATION AT CHANGE 006 OR EARLIER**  
**D206-558-043 DUAL MIRROR INSTALLATION AT CHANGE 006 OR EARLIER**

REF TCCA STC: SH92-17  
 REF FAA STC: SH1031NE  
 REF LBA STC 0796/3034  
 REF ANAC STC 2010S10-08

Dart Aerospace Ltd. has received information indicating that under certain circumstances on **D206-558-041/-043** Cargo Mirror Installations at **CHANGE 006 or earlier**, the D2065 or D2066 Arm may crack during flight, and could cause the D2011-101 mirror to separate from the assembly and depart the aircraft in flight.

Dart Aerospace Ltd. recommends that operators with aircraft equipped with **D206-558-041/-043** Cargo Mirror Installations at **CHANGE 006 or earlier** amend the daily preflight inspection by checking D2065 or D2066 Arm for cracks. If a crack is noticed, operators must perform the following as applicable:


### REPLACEMENT OF D2065 ARM ON D206-558-041 SINGLE MIRROR INSTALLATION :


1. Remove and discard existing D2065 Arm and D2057 Plug.
2. Procure improved D2065 Arms and D2057 Plugs from Dart Aerospace Ltd. referencing this Service Bulletin.
3. Install improved D2065 Arm and D2057 Plug in accordance with Figure 2 of D206-558, Figure 25.2 of ICA-D206-558, or Figure 1 of this service bulletin.
4. Install D2011-101 Mirror to replacement D2065 Arm using D3014-1 Locknut as shown in Figure 3 of D206-558, Figure 25.3 of ICA-D206-558, or Figure 1 of this service bulletin.

### REPLACEMENT OF D2066 ARM ON D206-558-043 DUAL MIRROR INSTALLATION :

1. Remove and discard the existing D2066 Arm and associated parts/hardware. Per DSI 9416, the D2066 Arm also includes 2 X D2052 Brackets, 2 X D2055 Clamps, a D2056 Bellcrank, 2 X D2054 Bushings, and attaching hardware.
2. Procure improved D2066 Arms from Dart Aerospace Ltd. referencing this Service Bulletin.
3. Install improved D2066 Arm in accordance with Figure 2 of D206-558, Figure 25.2 of ICA-D206-558, or Figure 1 of this service bulletin.
4. Install D2011-101 Mirror to replacement D2066 Arm using D3014-1 Locknut as shown in Figure 3 of D206-558, Figure 25.3 of ICA-D206-558, or Figure 1 of this service bulletin.

Dart Aerospace Ltd. regrets any inconvenience this may cause.

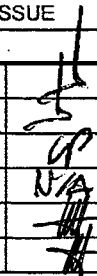A	NEW ISSUE	MB	11.09.06
REV.	DESCRIPTION	BY	DATE
DESIGN		<b>DART AEROSPACE LTD</b>	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		REV. A	
MFG. APPR.		SHEET 1 OF 2	
APPROVED		SCALE	
DE APPR.	TITLE	NTS	
	SERVICE BULLETIN		
DATE	11.09.06	<small>COPYRIGHT © 2011 BY DART AEROSPACE LTD          THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS          NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT          WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

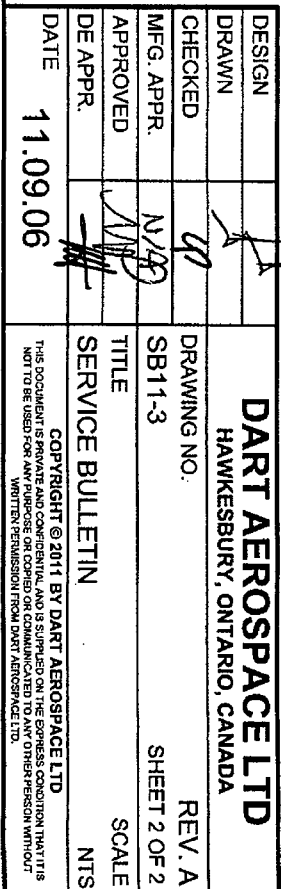

## D206-558-041/-043 SINGLE/DUAL MIRROR INSTALLATION